Eskom	Technical ar	nd Generic Report	Matimba Power Station
Title: Matimba Power Si 2023 emissions re		Document Identifier	r: RP/247/041
		Plant Location:	Emission management
		Area of Applicability	/: Matimba Power Station
		Functional Area Applicability:	Environment
		Revision:	2
		Total Pages:	32
		Report Date:	November 2023
		Disclosure Classification:	Controlled
Compiled by	Functional	Responsibility	Authorized by
₩ <u></u> .	Attination		Wikus van Rensburg
KH Ramahlare	MC Mamab	olo	Obakeng Mabotja
Senior Advisor Environment	Environme	ntal Manager	General Manager
Date: 2024-04-18	Date: 18/04	/2024	Date: 2024-04-19

Content

			i ugo
1.	Repo	ort Summary	5
2.	Emis	sion information	6
	2.1	Raw materials and products	6
	2.2	Abatement technology	6
	2.3	Emissions reporting	7
		2.3.1 Particulate Matter Emissions	7
		2.3.2 Gaseous Emissions	13
		2.3.3 Total Volatile Organic Compounds	19
		2.3.4 Greenhouse gas (CO ₂) emissions	20
	2.4	Daily power generated	20
	2.5	Pollutant Tonnages	
	2.6	Operating days in compliance to PM AEL Limit	
	2.7	Operating days in compliance to SOx AEL Limit	
	2.8	Operating days in compliance to NOx AEL Limit	
	2.9	Reference values	
	2.10	Continuous Emission Monitors	
		2.10.1 Reliability	
		2.10.2 Changes, downtime, and repairs	
		2.10.3 Sampling dates and times	
		Units Start-up information	
		Emergency generation	
		Complaints register	
	2.14	Air quality improvements and social responsibility conducted.	
		2.14.1 Air quality improvements	
		2.14.2 Social responsibility conducted.	
		Ambient air quality monitoring	
		Electrostatic precipitator and Sulphur plant status	
	2.17	General	
3.	Attac	hments	
4.	Repo	ort Conclusion	
Tab	ole 1: (Quantity of Raw Materials and Products used/produced for the month	6
Tab	le 2: /	Abatement Equipment Control Technology Utilised	6
Tab	le 3: E	Energy Source Material Characteristics.	7
Tab	ole 4: 1	Fotal volatile compound estimates	19
		Daily power generated per unit in MWh for the month of November 2023	
Tab	ole 6: F	Pollutant tonnages for the month of November 2023	24
Tab	le 7:	Operating days in compliance with PM AEL limit of November 2023	24

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Table 8: Operating days in compliance with SOx AEL limit of November 2023
Table 9: Operating days in compliance with NOx AEL limit of November 2023
Table 10: Reference values for data provided, November 2023
Table 11: Average percentage (%) availability of monitors for the month of November 2023
Table 12: Dates of last conducted CEMS verification tests for PM, SO ₂ and NOx27
Table 13: Start-up information
Table 14: Emergency generation 29
Table 15: Complaints
Figures
Figure 1: Particulate matter daily average emissions against emission limit for unit 1 for the month of November 20237
Figure 2: Particulate matter daily average emissions against emission limit for unit 2 for the month of November 2023
Figure 3: Particulate matter daily average emissions against emission limit for unit 3 for the month of November 2023
Figure 4: Particulate matter daily average emissions against emission limit for unit 4 for the month of November 2023
Figure 5: Particulate matter daily average emissions against emission limit for unit 6 for the month of November 2023
Figure 6: SO2 daily average emissions against emission limit for unit 1 for the month of April202313
Figure 7: SO2 daily average emissions against emission limit for unit 2 for the month of November 2023 13
Figure 8: SO2 daily average emissions against emission limit for unit 3 for the month of November 2023 14
Figure 9: SO2 daily average emissions against emission limit for unit 4 for the month of November 202314
Figure 10: SO2 daily average emissions against emission limit for unit 6 for the month of November 2023
Figure 11: NOx daily average emissions against emission limit for unit 1 for the month of November 2023
Figure 12: NOx daily average emissions against emission limit for unit 2 for the month of November 2023
Figure 13: NOx daily average emissions against emission limit for unit 3 for the month of November 2023
Figure 14: NOx daily average emissions against emission limit for unit 4 for the month of November 2023
Figure 15: NOx daily average emissions against emission limit for unit 6 for the month of November 202318
Figure 16: Unit 1 daily generated power in MWh for the month of November 2023
Figure 17: Unit 2 daily generated power in MWh for the month of November 2023
Figure 18: Unit 3 daily generated power in MWh for the month of November 2023

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	4 of 32

Figure 19: Unit 4 daily generated power in MWh for the month of November 2023
Figure 20: Unit 6 daily generated power in MWh for the month of November 2023

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	5 of 32

1. Report Summary

Matimba Power Station was issued with an Atmospheric Emission License (H16/1/13-WDM05) in September 2022. The License requires the license holder to submit monthly reports to the Department. This report is the revision 2 of the report submitted to the licensing authority in November 2023. The revision of the report was necessitated by changes applied to the Matimba Emission Reporting tool (ERT V12.2021 to ERT V02.2024VF), which included the implementation of the spot test correlations and parallel tests (QAL 2) tests performed in July-August 2023 and the usage of surrogate particulate emissions values when monitors exceed their range due to high actual emissions using the Deutsch calculation.



During the period under review, Matimba experienced one-hundred and eight (108) exceedances of the daily particulate matter emission limit (50mg/Nm3), ninety-four (94) of these exceedances occurred outside of the 48-hour grace period and were recorded on the Eskom incident management process as non-compliance to the Atmospheric Emissions Licence and fourteen (14) exceedances occurred within the 48-hour grace period.

There were no exceedances of the monthly SOx limit (3500mg/Nm3) and the daily NOx emission limit (750mg/Nm3) occurred.

The flue gas conditioning plant (SO3 Plant) availability for the month of November 2023 was 94%. Issues that affected the availability were addressed and the plants returned to operation.

More information regarding above mentioned issues is provided in the relevant sections within the report.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page.	6 of 32

2. Emission information

2.1 Raw materials and products

Table 1: Quantity of Raw Materials and Products used/produced for the month.

Raw Materials and Products used	Raw Material Type	Unit	Maximum Permitted Consumption Rate (Quantity)	Consumption Rate
	Coal	Tons/month	1 500 000	904 130
	Fuel Oil	Tons/month	1 200	1548,087
Production Rates	Product/ By- Product Name	Unit	Maximum Production Capacity Permitted (Quantity)	Production Rate
	Energy	MW	4000	2208,86

The consumption rates for the month of November 2023 exceeded the permitted maximum limits of 1200T. The exceedance was caused by units' constant combustion support during low loads.

2.2 Abatement technology

Table 2: Abatement Equipment Control Technology Utilised

Associated Unit	Technology Type	Minimum utilisation (%)	Efficiency (%)
Unit 1	Electrostatic Precipitator	100%	99,999%
Unit 2	Electrostatic Precipitator	100%	99,995%
Unit 3	Electrostatic Precipitator	100%	99,999%
Unit 4	Electrostatic Precipitator	100%	99,999%
Unit 5	Electrostatic Precipitator	100%	99,998%
Unit 6	Electrostatic Precipitator	100%	99,999%
Associated	Technology Type	Minimum utilisation	Actual Utilisation (%)
Unit		(%)	
Unit 1	SO₃ Plant	100%	91%
Unit 2	SO₃ Plant	100%	57%
Unit 3	SO₃ Plant	100%	99%
Unit 4	SO ₃ Plant	100%	99%
Unit 5	SO ₃ Plant	100%	98%
Unit 6	SO ₃ Plant	100%	96%

Flue gas conditioning plant availability was below the required 100% for all six (06) units due to unplanned breakdowns and defects. Defects were addressed and plants returned to service. Unit 2 was taken down on outage on 11 November 2023

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page.	7 of 32

 Table 3: Energy Source Material Characteristics.


	Characteristic	Stipulated Range (Unit)	Monthly Average Content
Coal burned	Sulphur Content	1.6%	1,22%
Coal burned	Ash Content	40%	34,97%

Energy source characteristics remained within the ranges stipulated in the license.

2.3 Emissions reporting

2.3.1 Particulate Matter Emissions

Parallel spot tests results were applied for all the units. Correlation spot tests curves were applied for calculations on unit 1,2,3 and 5. The spot test correlation for PM emissions on Unit 4 and 6 have failed the minimum requirements outlined in the Eskom emission calculation Methodology and were not applied.

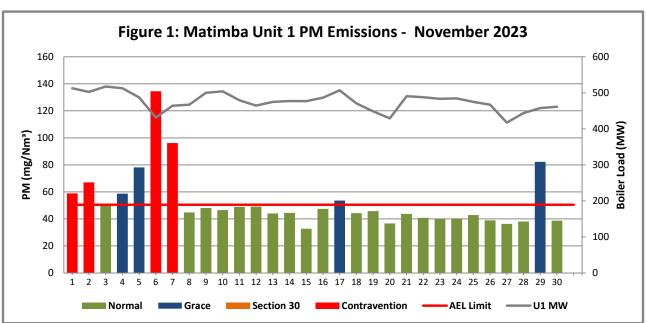

Unit 1 Particulate Emissions

Figure 1: Particulate matter daily average emissions against emission limit for unit 1 for the month of November 2023

Interpretation:

Unit 1 exceeded the daily particulate emission limit of 50mg/Nm3 on 1, 2, 4 to 7,17and 29 November 2023. The exceedance was due to unavailability of the ash conveyance system that led to ash accumulation on the dust handling plants leading to high hopper levels within the flue gas cleaning system and reducing the efficiency of the abatement technology (electrostatic precipitator fields. Exceedances of 1, 2, 6 and 7 occurred outside the 48-hour grace period.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report Rev 2	Unique Identifier:	RP/247/041
	Revision:	2
	Page:	8 of 32

Unit 2 Particulate Emissions

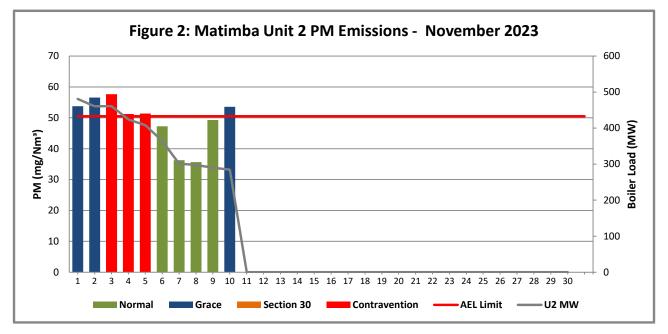


Figure 2: Particulate matter daily average emissions against emission limit for unit 2 for the month of November 2023


Interpretation:

Unit 2 exceeded the daily particulate emission limit of 50mg/Nm3 on 1 to 5 and 10 November 2023. The exceedance was due to unavailability of the ash conveyance system that led to ash accumulation on the dust handling plants leading to high hopper levels within the flue gas cleaning system and reducing the efficiency of the abatement technology (electrostatic precipitator fields. Exceedances of 3 to 5 occurred outside the 48-hour grace period.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report Rev 2	Unique Identifier:	RP/247/041
	Revision:	2
	Page:	9 of 32

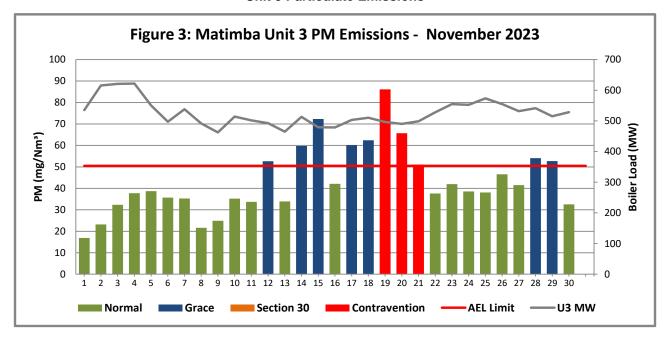

Unit 3 Particulate Emissions

Figure 3: Particulate matter daily average emissions against emission limit for unit 3 for the month of November 2023


Interpretation:

Unit 3 exceeded the daily particulate emission limit of 50mg/Nm3 on 12,14,15,17 to 21,28 and 29 November 2023. Exceedances of 19 to 21 November 2023 occurred outside of the 48-hour grace period and were recorded on the Eskom incident management process as non-compliance to the Atmospheric Emissions Licence. The exceedances were due to unavailability of the ash conveyance system that led to ash accumulation on the dust handling plants leading to high hopper levels within the flue gas cleaning system and reducing the efficiency of the abatement technology (electrostatic precipitator fields.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	10 of 32

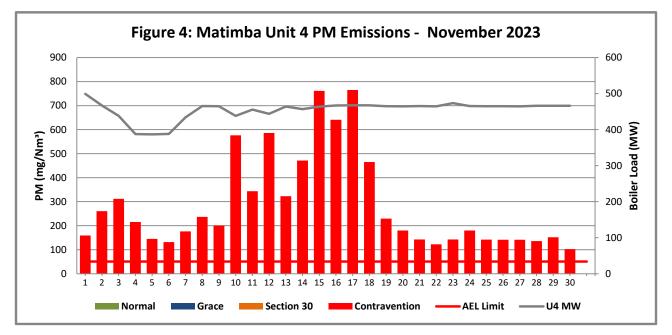

Unit 4 Particulate Emissions

Figure 4: Particulate matter daily average emissions against emission limit for unit 4 for the month of November 2023


Interpretation:

Unit 4 Particulate matter exceeded the daily limit of 50 mg/Nm³ on 1 to 30 November 2023. All exceedances occurred outside of the 48-hour grace period and were recorded on the Eskom incident management process as non-compliance to the Atmospheric Emissions Licence. The exceedances were due to defects on the dust handling plants leading to high hopper levels within the flue gas cleaning system and reducing the efficiency of the abatement technology (electrostatic precipitator fields). The investigation into the causes of the exceedances were done and corrective measure put in place to correct the root causes.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	11 of 32

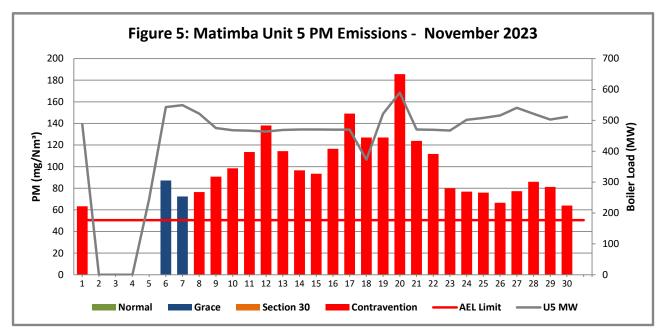

Unit 5 Particulate Emissions

Figure 5: Particulate matter daily average emissions against emission limit for unit 5 for the month of November 2023


Interpretation:

Unit 5 Particulate matter exceeded the daily limit of 50 mg/Nm³ on 1, 6 to 30 November 2023. Exceedances of 1, 8 to 30 November 2023 occurred outside of the 48-hour grace period and were recorded on the Eskom incident management process as non-compliance to the Atmospheric Emissions Licence. The exceedances were due to defects on the dust handling plants leading to high hopper levels within the flue gas cleaning system and reducing the efficiency of the abatement technology (electrostatic precipitator fields). The investigation into the causes of the exceedances were done and corrective measure put in place to correct the root causes.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	12 of 32

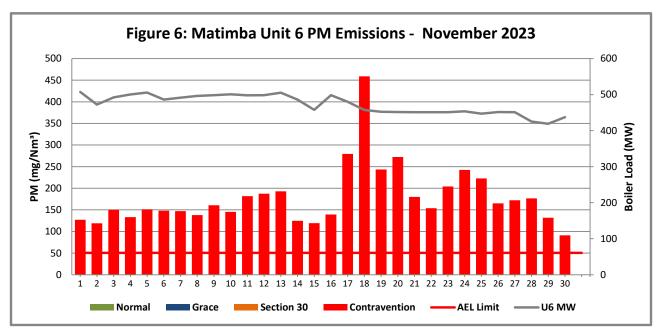

Unit 6 Particulate Emissions

Figure 6: Particulate matter daily average emissions against emission limit for unit 6 for the month of November 2023

Interpretation:

Unit 6 Particulate matter exceeded the daily limit of 50 mg/Nm3 on 1 to 30 November 2023. All exceedances occurred outside the 48-hour grace period and were recorded on the Eskom incident management process as non-compliance to the Atmospheric Emissions Licence. The exceedances were due to defects on the dust handling plants leading to high hopper levels within the flue gas cleaning system and reducing the efficiency of the abatement technology (electrostatic precipitator fields). The investigation into the causes of the exceedances were done and corrective measure put in place to correct the root causes.


CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	13 of 32

2.3.2 Gaseous Emissions

Gaseous emissions analyzers calibration for all 6 units were performed in November 2023 as per the AEL requirements. The quality assurance spot tests were performed on the monitors in August 2023 and the test results are used for the November 2023 emission calculation.

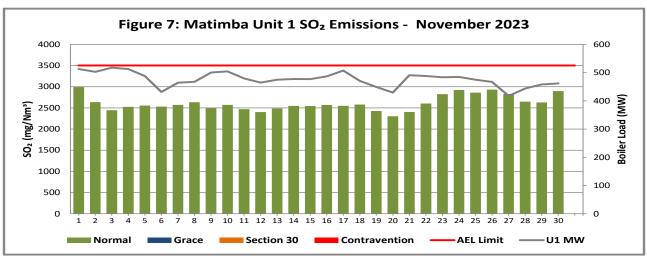


Unit 1 SO₂ Emissions

Figure 7: SO2 daily average emissions against emission limit for unit 1 for the month of November 2023

Interpretation:

All daily averages below SO₂ emission monthly limit of 3500 mg/Nm³.

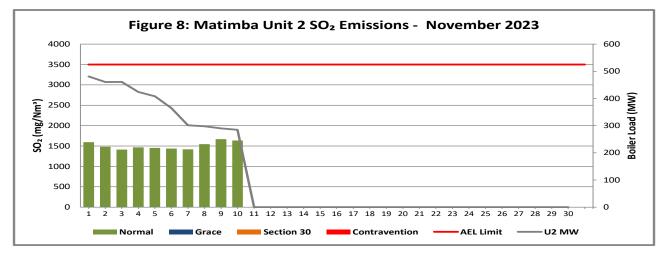

Unit 2 SO₂ Emissions

Figure 8: SO2 daily average emissions against emission limit for unit 2 for the month of November 2023

Interpretation:

All daily averages below SO2 emission monthly limit of 3500 mg/Nm3

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	14 of 32

Unit	2	SO.	Emissions
Unit	3	3U ₂	Emissions


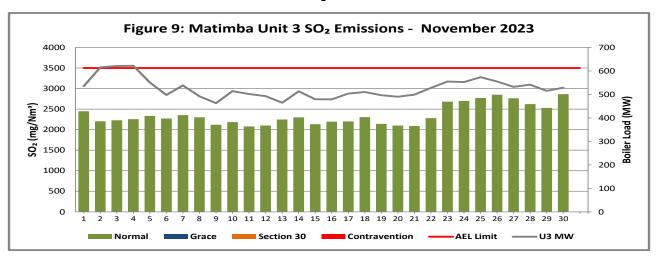


Figure 9: SO2 daily average emissions against emission limit for unit 3 for the month of November 2023

Interpretation:

All daily averages below SO₂ emission monthly limit of 3500 mg/Nm³.

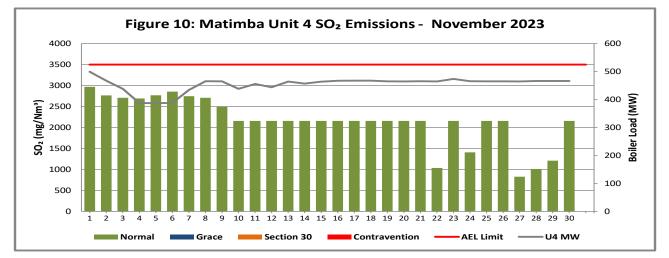

Unit 4 SO₂ Emissions

Figure 10: SO2 daily average emissions against emission limit for unit 4 for the month of November 2023

Interpretation:

All daily averages below SO₂ emission monthly limit of 3500 mg/Nm³.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	15 of 32

Unit 5 SO₂ Emissions


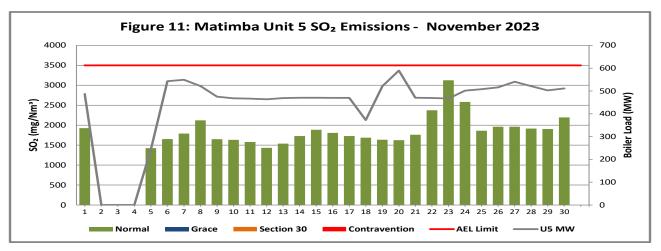


Figure 11: SO2 daily average emissions against emission limit for unit 5 for the month of November 2023

Interpretation:

All daily averages below SO₂ emission monthly limit of 3500 mg/Nm³.

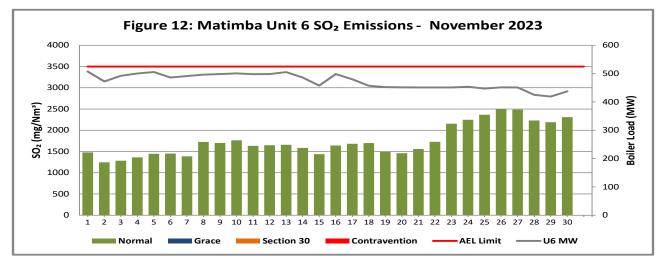

Unit 6 SO₂ Emissions

Figure 12: SO2 daily average emissions against emission limit for unit 6 for the month of November 2023

Interpretation:

All daily averages remained below SO₂ emission monthly limit of 3500 mg/Nm³.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	16 of 32

Unit 1 NO_x Emissions

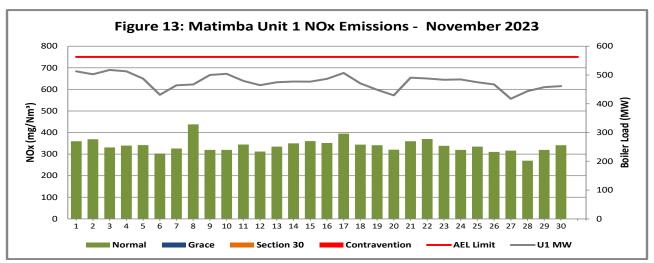


Figure 13: NOx daily average emissions against emission limit for unit 1 for the month of November 2023

Interpretation:

All daily averages below NOx emission limit of 750 mg/Nm³.

Unit 2 NO_x Emissions

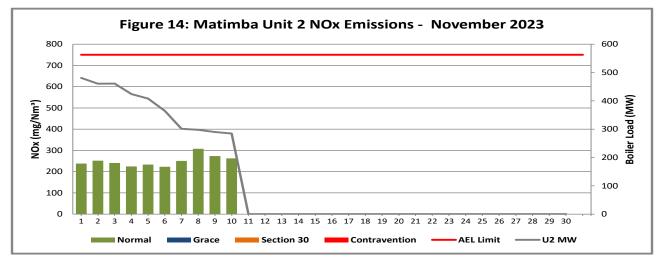


Figure 14: NOx daily average emissions against emission limit for unit 2 for the month of November 2023

Interpretation:

All daily averages below NOx emission limit of 750 mg/Nm³.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	17 of 32

Unit 3 NO_x Emissions


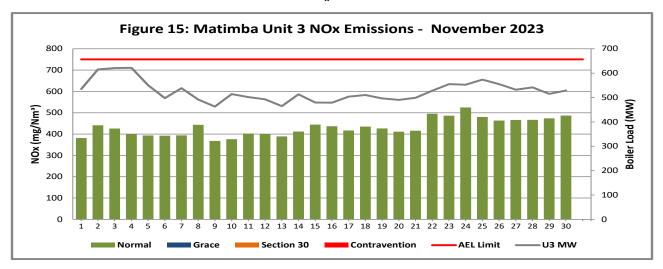


Figure 15: NOx daily average emissions against emission limit for unit 3 for the month of November 2023

Interpretation:

All daily averages below NOx emission limit of 750 mg/Nm³.

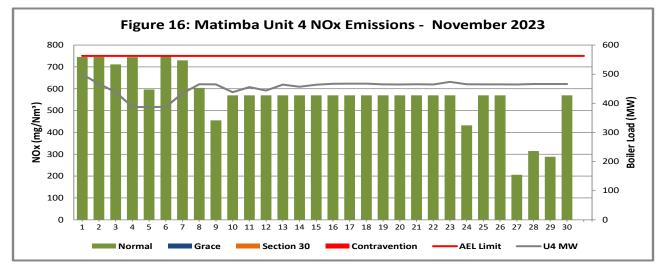

Unit 4 NO_x Emissions

Figure 16: NOx daily average emissions against emission limit for unit 4 for the month of November 2023

Interpretation:

All daily averages below NOx emission limit of 750 mg/Nm³.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	18 of 32

Unit 5 NO_x Emissions


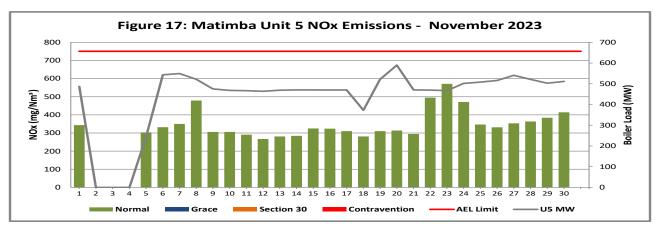


Figure 17: NOx daily average emissions against emission limit for unit 5 for the month of November 2023

Interpretation:

All daily averages below NOx emission limit of 750 mg/Nm³.

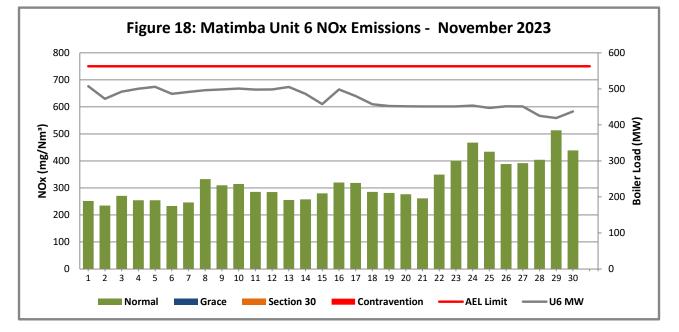

Unit 6 NO_x Emissions

Figure 18 NOx daily average emissions against emission limit for unit 6 for the month of November 2023

Interpretation:

All daily averages below NOx emission limit of 750 mg/Nm³.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report Rev 2	Unique Identifier:	RP/247/041
	Revision:	2
	Page:	19 of 32

2.3.3 Total Volatile Organic Compounds

Table 4: Total volatile compound estimates

Eskom

CALCULATION OF EMISSIONS OF TOTAL VOLATILE COMPOUNDS FROM FUEL OIL STORAGE TANKS*

Date:	Wednesday, 27 December 2023					
Station:	Matimba Power Station					
Province:	Limpopo Province					
Tank no.	1-4					
Description:	Outdoor fuel oil storage tank					
Tank Type:	Vertical fixed roof (vented to atmosphere)					
Material stored:	Fuel Oil 150					
	MONTHLY INPUT DATA FO	OR THE STATIC	ON			
	Please only insert relevant monthly data	inputs into th	e <u>blue cells</u> belo	W		
	Choose from a dropdown mer	nu in the <u>greer</u>	<u>ı cells</u>			
	The total VOC emissions for the m	onth are in the	e <u>red cells</u>			
	IMPORTANT: Do not change any other cel	lls without cons	ulting the AQ CoE			
MONTH:	November					
GENERAL INFORM	IATION:		Data	Unit		
Total number of f	uel oil tanks:		4	NA		
Height of tank:			13,34	m		
Diameter of tank:			9,53	m		
Net fuel oil throug	ghput for the month:		<u>1548,087</u>			
Molecular weight	of the fuel oil:		166,00	Lb/lb-mole		
METEROLOGICAL	DATA FOR THE MONTH		Data	Unit		
Daily average am	bient temperature		26,22	C°		
Daily maximum a	mbient temperature		32,63	°C		
Daily minimum a	mbient temperature		20,19	°C		
Daily ambient ten	nperature range		12,44	°C		
Daily total insolat	ion factor		6,14	kWh/m²/day		
Tank paint colou	r		<u>Grey/medium</u>	NA		
Tank paint solar a	0,68	NA				
FINAL OUTPUT: Result Unit						
Breathing losses: 0,59 kg/month						
Working losses: 0,04 kg/month						
TOTAL LOSSES (Total TVOC Emissions for the month): 0,63 kg/month						
	rformed on this spreadsheet are taken from the 1996. This spreadsheet is derived from material		0			

Tanks - January 1996. This spreadsheet is derived from materials provided by Jimmy Peress, PE, Tritech Consulting Engineers, 85-93 Chevy Chase Street, Jamaica, NY 11432 USA, Tel - 718-454-3920, Fax - 718-454-6330, e-mail -PeressJ@nyc.rr.com.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page.	20 of 32

2.3.4 Greenhouse gas (CO₂) emissions

CO₂ emissions are reported in terms of the Greenhouse gas reporting regulations (GN 43712, GNR. 994/2020) and are not included in the monthly AEL compliance report.

2.4 Daily power generated.

Table 5: Daily power generated per unit in MWh for the month of November 2023

Date	Unit 1	Unit 2	Unit 3	Unit 4	Unit 5	Unit 6
2023/11/01	11351,4	10220,2	11661,7	10863,6	9395,91	11018,9
2023/11/02	11061,5	9775,75	13445,6	10131,2	0	10262,3
2023/11/03	11400,8	9798,01	13549,9	9491,11	0	10669,3
2023/11/04	11281	8981,58	13587,6	8326,06	0	10863,7
2023/11/05	10729,3	8642,13	12044,2	8298,03	102,737	10966,8
2023/11/06	9428,37	7650,92	10792,9	8313,69	11700	10529,2
2023/11/07	10188,6	6202,45	11748,2	9330,59	11937,6	10652,4
2023/11/08	10259,8	6131,27	10680,5	10069,9	11290,3	10784,6
2023/11/09	10975,4	5911,17	10013,7	10062,5	10255,1	10752,1
2023/11/10	11093,4	2213,46	11190,9	9502,9	10099	10833
2023/11/11	10519,8	0	10914,1	9819,53	10077,9	10783,3
2023/11/12	10187,8	0	10726,4	9572,66	9944,25	10793,1
2023/11/13	10433	0	10097,9	9993,96	10011,8	10934,8
2023/11/14	10492,8	0	11161,8	9871,47	10056,5	10564,9
2023/11/15	10480,7	0	10414,1	10003,1	10049,9	9870,37
2023/11/16	10669,6	0	10400,4	10082,6	10027,9	10821,1
2023/11/17	11121,6	0	10927,4	10107,2	10027,6	10399,4
2023/11/18	10314,1	0	11093	10094,3	53,9491	9887,05
2023/11/19	9848,42	0	10797,9	10045	6932,06	9777,56
2023/11/20	9344,52	0	10637,5	10025	12674,9	9729,49
2023/11/21	10784,6	0	10813,7	10035,4	10017,6	9741,69
2023/11/22	10707,9	0	11438,3	10014,3	10008,5	9726,56
2023/11/23	10609,7	0	12076	10251,6	9945,44	9702,94
2023/11/24	10637	0	11975,4	10036,6	10704,9	9751,02
2023/11/25	10418,8	0	12474,4	10037,7	10839,2	9579,41
2023/11/26	10245,5	0	12093,9	10035,1	10987,7	9706,6
2023/11/27	9087,62	0	11540,8	10023,3	11588	9712,6
2023/11/28	9712,25	0	11759,9	10048,4	11139,6	6680,31
2023/11/29	9999,96	0	11176,6	10042	10727,1	8990,21
2023/11/30	10118,1	0	11454,5	10043,8	10862,8	9434,56

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

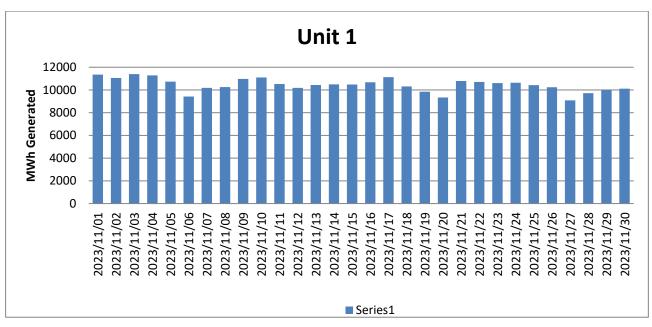


Figure 19: Unit 1 daily generated power in MWh for the month of November 2023

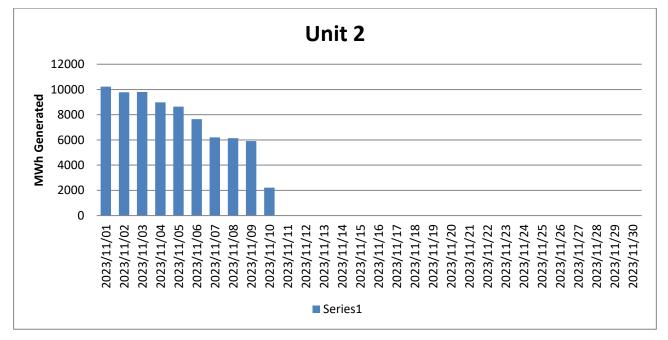


Figure 20: Unit 2 daily generated power in MWh for the month of November 2023

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

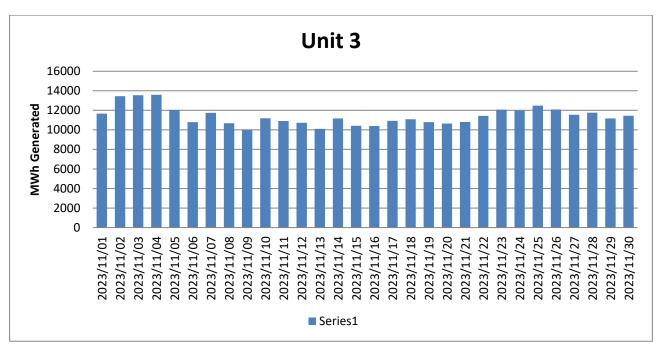


Figure 21: Unit 3 daily generated power in MWh for the month of November 2023

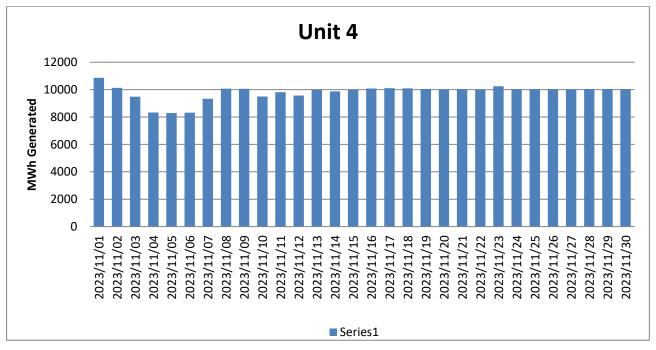


Figure 22: Unit 4 daily generated power in MWh for the month of November 2023

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	23 of 32

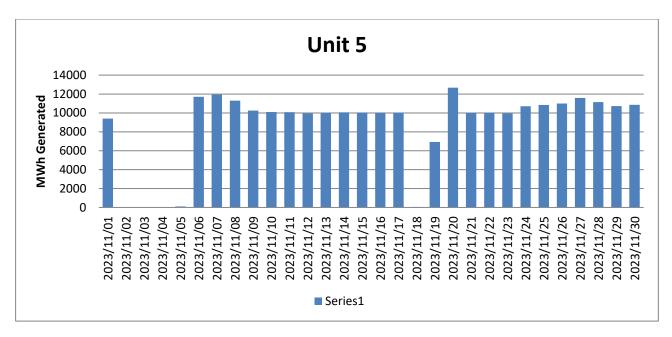


Figure 23: Unit 5 daily generated power in MWh for the month of November 2023

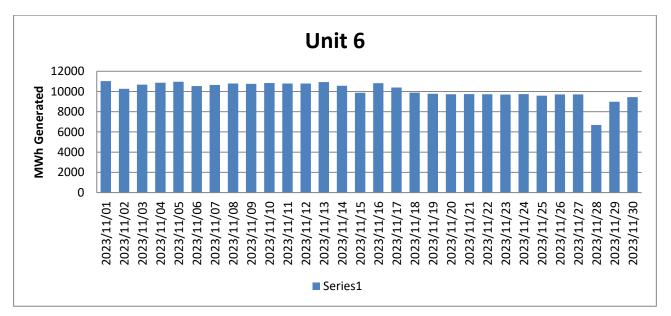


Figure 24: Unit 6 daily generated power in MWh for the month of November 2023

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

2.5 Pollutant Tonnages

The emitted pollutant tonnages for November 2023 are provided in table 6.

Table 6: Pollutant tonnages for the month of November 2023

Associated Unit/Stack	PM (tons)	SO ₂ (tons)	NO _x (tons)
Unit 1	103.9	5 160.0	671.2
Unit 2	36.3	1 107.4	183.5
Unit 3	100.3	5 425.1	995.3
Unit 4	161.8	3 478.3	919.7
Unit 5	129.6	2 794.4	522.3
Unit 6	51.5	3 035.5	552.9
SUM	583.4	21 000.7	3 845.0

2.6 Operating days in compliance to PM AEL Limit

Table 7: Operating days in compliance with PM AEL limit of November 2023

Associated Unit/Stack	Normal	Grace	Section 30	Contrave ntion	Total Exceedance	Average PM (mg/Nm³)
Unit 1	22	4	0	4	8	52.4
Unit 2	4	3	0	3	6	49.3
Unit 3	20	7	0	3	10	43.5
Unit 4	0	0	0	30	30	286.1
Unit 5	0	0	0	24	24	98.7
Unit 6	0	0	0	30	30	178.6
SUM	46	14	0	94	108	

2.7 Operating days in compliance to SOx AEL Limit

Table 8: Operating days in compliance with SOx AEL limit of November 2023

Associated Unit/Stack	Normal	Grace	Section 30	Contravention	Total Exceedance	Average SO ₂ (mg/Nm³)
Unit 1	30	0	0	0	0	2 612.1
Unit 2	10	0	0	0	0	1 511.7
Unit 3	30	0	0	0	0	2 354.3
Unit 4	30	0	0	0	0	2 157.2
Unit 5	27	0	0	0	0	1 869.6
Unit 6	30	0	0	0	0	1 751.2
SUM	157	0	0	0	0	

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	25 of 32

2.8 Operating days in compliance to NOx AEL Limit

Table 9: Operating days in compliance with NOx AEL limit of November 2023

Associated Unit/Stack	Normal	Grace	Section 30	Contravention	Total Exceedance	Average NOx (mg/Nm ³)
Unit 1	30	0	0	0	0	339.4
Unit 2	10	0	0	0	0	250.4
Unit 3	30	0	0	0	0	431.6
Unit 4	30	0	0	0	0	569.6
Unit 5	27	0	0	0	0	349.3
Unit 6	30	0	0	0	0	319.9
SUM	157	0	0	0	0	

2.9 Reference values

 Table 10:
 Reference values for data provided, November 2023

Compound / Parameter	Units of Measure	Unit 1	Unit 2	Unit 3	Unit 4	Unit 5	Unit 6
Oxygen	%	7.32	7.42	6.27	8.02	7.69	8.29
Moisture	%	3.87	3.38	3.99	2.94	4.06	2.00
Velocity	m/s	24.3	26.9	26.5	20.5	22.0	25.8
Temperature	°C	140.6	114.0	131.5	128.3	128.5	166.4
Pressure	mBar	928.8	936.2	916.5	929.8	944.6	910.0

2.10 Continuous Emission Monitors

2.10.1 Reliability

Continuous emission monitors were available for more than 80% of the reporting period. The emitted pollutant tonnages for November 2023 are provided in table 6.

Table 11: Average percentage (%) availability of monitors for the month of November 2023.

Associated Unit/Stack	РМ	SO2	NO
Unit 1	100,0	99,9	99,9
Unit 2	100,0	83,0	65,3
Unit 3	100,0	99,9	99,9
Unit 4	100,0	99,9	99,9
Unit 5	100,0	100,0	100,0

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Unit 6 100,0

100,0 99,9

2.10.2 Changes, downtime, and repairs

Unit 1

- No adjustments done on the CEMs.
- No downtime or repairs done on the particulate monitors

Unit 2

- No adjustments done on the CEMs.
- No downtime or repairs done on the particulate monitors

Unit 3

- No adjustments done on the CEMs.
- No downtime or repairs done on the particulate monitors

Unit 4

- No adjustments done on the CEMs.
- No downtime or repairs done on the particulate monitors

Unit 5

- No adjustments done on the CEMs.
- No downtime or repairs done on the particulate monitors

Unit 6

- No adjustments done on the CEMs.
- No downtime or repairs done on the particulate monitors

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

2.10.3 Sampling dates and times

Table 12: Dates of last full conducted CEMS verification tests for PM for unit 4 and 6 only

Name of ser	vice provider:	Stacklabs Environm	ental Services CC	
Address of service provider:		10 Chisel Street Boltonia Krugersdorp 1739		
Stack/ Unit	РМ	SO ₂	NOx	CO2
1	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13
2	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13
3	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13
4	2021/07/13 14h31	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13
5	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13
6	2020/09/09 06h41	New sampling tests in table 13	New sampling tests in table 13	New sampling tests in table 13

Note: The CEMS verification tests for PM, SO₂ and NOx were performed in October 2022 and failed. The spot tests were done in August 2023.

Table 13: Dates of last conducted CEMS Spot verification tests for PM, SO2 and NOx (without unit 4	
and 6 PMs)	

Name of ser	vice provider:	Levego Environmental services		
Address of s	service provider:	Building R6 Pineland site Ardeer Road Modderfontein 1645		
Stack/ Unit	РМ	SO ₂	NOx	CO ₂
1	2023/08/01 19h33	2023/08/01 19:33	2023/08/01 19:33	2023/08/01 19:33
2	2023/07/29 21:17	2023/07/29 21:17	2023/07/29 21:17	2023/07/29 21:17
3	2023/08/06 03:00	2023/08/06 03:00	2023/08/06 03:00	2023/08/06 03:00
4	Dates in table 12 above	2023/08/04 19:39	2023/08/04 19:39	2023/08/04 19:39
5	2023/08/05 07:30	2023/08/05 07:30	2023/08/05 07:30	2023/08/05 07:30

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Page:

28 of 32

6	Dates in table 12 above	2023/08/05 15:52	2023/08/05 15:52	2023/08/05 15:52

Note: The CEMS Spot verification tests for PM, SO₂ and NOx were performed in August 2023. PM spot verification test results for units 4 and 6 failed and old curves are still in use.

2.11 Units Start-up information

 Table 14:
 Start-up information

Unit	5	
Fires in	2023/11/05	14h57
Synchronization with Grid	2023/11/05	19h56
Emissions below limit	2023/11/06	10h01
Fires in, to synchronization	4,59	HOURS
Synchronization to < Emission limit	14,5	HOURS

Unit	5	
Fires in	2023/11/05	21h20
Synchronization with Grid	2023/11/05	22h53
Emissions below limit	2023/11/06	10h01
Fires in, to synchronization	1,33	HOURS
Synchronization to < Emission limit	11,8	HOURS

Unit	5	
Fires in	2023/11/18	20h00
Synchronization with Grid	2023/11/19	08h36
Emissions below limit	2023/11/20	04h33
Fires in, to synchronization	12,36	HOURS
Synchronization to < Emission limit	19,57	HOURS

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	29 of 32

Unit	6	
Fires in	2023/11/28	10h57
Synchronization with Grid	2023/11/28	16h56
Emissions below limit	2023/11/28	18h13
Fires in, to synchronization	5,59	HOURS
Synchronization to < Emission limit	1,17	HOURS

2.12 Emergency generation

Table 15: Emergency generation

	Unit 1	Unit 2	Unit 3	Unit 4	Unit 5	Unit 6
Emergency Generation hours declared by national Control	720	720	720	720	720	720
Emergency Hours declared including hours after stand down	720	227	720	720	591	714
Days over the Limit during Emergency Generation	4	0	12	29	21	1

2.13 Complaints register.

Table 16: Complaints

Source Code/ Name	Root Cause Analysis	Calculation of Impacts/ emissions associated with the incident	Dispersion modelling of pollutants where applicable	Measures implemented to prevent reoccurrence	Date by which measure will be implemented
None					

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Matimba Power Station November 2023 emissions report	Unique Identifier:	RP/247/041
Rev 2	Revision:	2
	Page:	30 of 32

2.14 Air quality improvements and social responsibility conducted.

2.14.1 Air quality improvements

None

2.14.2 Social responsibility conducted.

None

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

Ambient air quality monitoring

Ambient air quality monitoring report was not available at the time of publishing this report.

2.15 Electrostatic precipitator and Sulphur plant status

Unit 1

- 9 fields out of service, will be repaired during next opportunity.
- No abnormalities on the SO3 plant. Preventive maintenance done during the month.

Unit 2

- 10 fields out of service, will be repaired during next opportunity.
- No abnormalities on the SO3 plant. Preventative maintenance done during the month.
- Unit shut down on 10 November 2023 for MO outage.

Unit 3

- 1 field out of service, will be repaired during next opportunity.
- No abnormalities on the SO3 plant. Preventative maintenance done during the month.

Unit 4

- 5 fields out of service, will be repaired during next opportunity.
- No abnormalities on the SO3 plant. Preventative maintenance done during the month.

Unit 5

- 4 fields out of service, will be repaired during next opportunity.
- No abnormalities on the SO3 plant. Preventative maintenance done during the month.

Unit 6

- 8 fields out of service, will be repaired during next opportunity.
- No abnormalities on the SO3 plant. Preventative maintenance done during the month.

SO3 common plant

• No abnormalities on the sulphur storage plant.

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.

2.16 General

Name and reference number of the monitoring methods used:

- 1. Particulate and gas monitoring according to standards
 - a. BS EN 14181:2004 Quality Assurance of Automated Measuring Systems
 - b. ESKOM internal standard 240-56242363 Emissions Monitoring and Reporting Standard

Sampling locations:

- 1. Stack one
 - a. Particulates:
 - i. S23º 40' 2.8" E027º 36' 34.8" 175m from ground level and 75m from the top.
 - b. Gas:
 - i. S23º 40' 2.8" E027º 36' 34.8" 100m from ground level and 150m from the top.
 - c. Stack height
 - i. 250 meter consist of 3 flues
- 2. Stack two
 - a. Particulates:
 - i. S23º 40' 14.8" E027º 36' 47.5" 175m from ground level and 75m from the top.
 - b. Gas:
 - i. S23° 40' 14.8" E027° 36' 47.5" 100m from ground level and 150m from the top. Stack height
 - i. 250 meter consist of 3 flues

3. Attachments

C.

None

4. Report Conclusion

The rest of the information demonstrating compliance with the emission license conditions is supplied in the annual emission report sent to your office.

Hoping the above will meet your satisfaction.

I hereby declare that the information in this report is correct.

Yours sincerely

Wikus van Rensburg

GENERAL MANAGER: MATIMBA POWER STATION

CONTROLLED DISCLOSURE

When downloaded from the document management system, this document is uncontrolled and the responsibility rests with the user to ensure it is in line with the authorised version on the system.